

## SLIM Release 1.00

### Product Tested:

**SLIM Firmware:** 4C089X01-01 R2.1.0.2295

**PC Programming Software:** 6A089X01-01 R2.0.0.0005

### Tested With:

**MSU Types:** APX7500, APX8500                      **MSU Firmware:** Various through R17.01.01

**Sirens:** Code3 Z3, Federal Signal SSP2000B, SSP3000B, SmartSirenSM and Whelen MCP03, Sapphire, CanTrol

### New Features/Performance Enhancements:

**Description:** The following features had been added and/or improved in Release 1.00.

FEATURE	DESCRIPTION
Siren compatibility expanded	Federal Signal SSP2000B, SSP2000B-200 and SSP3000 added to SLIM firmware and PC Programming Utility
Electronic serial number	Device serial number now stored in device memory and accessible via the PC Programming Utility
Electrical connection improvement	Connection to APX mobile radios more robust in electrically noisy environments
Power protection improvement	SLIM USB lines tolerant to out of sequence SLIM and APX mobile radio power and ground application during installation

### Issues Fixed since last major Release:

Issue	DESCRIPTION	Release
Control head lockup	In certain electrically noisy installations the USB signal between SLIM and the APX radio could hang up.	1.00
Out of sync O9 pursuit knob	If the pursuit knob on the APX O9 control head was moved when SLIM was disconnected, the knob position could be out of sync with light and siren functions.	1.00

Issue	DESCRIPTION	Release
PA volume of Z3 siren muted	The PA volume of the Code3 Z3 siren could be adjusted without the user's input.	1.00

### Known SLIM Issues in this Release:

Issue	DESCRIPTION
PC Programming Reset	PC Programming Utility tool may stop if USB cable is disconnected. PC Programming Utility can be restarted. <b>SLIM continues to function w/o issue</b>

### Known SLIM Limitations:

- None



Subscribe to our newsletter if you want to be informed about new releases and updates. Please visit <http://futurecom.com/support/newsletter/>